

**#07-08-61-006C: EI07118 - Underbody Noise, Pop, Creak, Body Mount (Install Upper Body Mount Insulators) - (Jul 24, 2008)****Subject:** EI07118 -- Underbody Noise, Pop, Creak, Body Mount (Install Upper Body Mount Insulators)**Models:** 2005-2008 HUMMER H2

This bulletin is being revised to adjust the labor time. Please discard Corporate Bulletin Number 07-08-61-006B (Section 08 -- Body and Accessories).

**Condition**

Some customers may comment on a noise coming from the underbody of the vehicle.

**Cause**

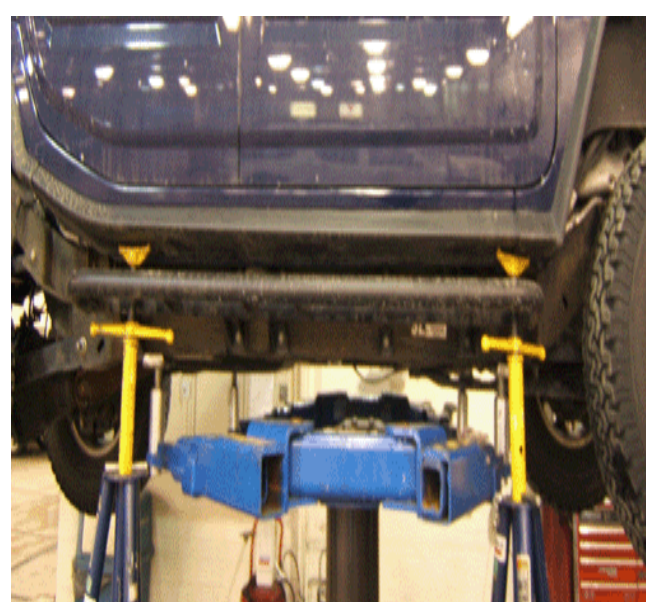
This condition may be due to body coning in the area of the upper body mounts.

**Correction**

Use the following procedure to install insulators to the upper body mounts. Do not attempt to repair any coning of the sheet metal on the underside of the body at the mount locations that may be observed when a body mount is serviced.

**Installation of Insulators to the Upper Body Mount:**

1. Raise the vehicle.
2. Loosen the lower body mounts on the right hand side of the vehicle.

**Jack Stand Location:**

3. Install jack stands on the right hand side of the vehicle to support the body (refer to graphic #1).
4. Slightly lower the vehicle just enough to provide access to the upper body mount.
5. Remove the upper body mounts one at a time and install the insulators as shown in graphics #2 and #3.

**Upper Body Mount -- Insulator (P/N 15899719) Location:****Upper Body Mount -- Insulator (P/N 15053229) Location:**

**Important:** Place a small amount of Instant Adhesive Gel, P/N 12345632 (in Canada, P/N 10953475) or equivalent to the top of the upper mount in order to hold the upper insulator in position during installation.

6. Raise the vehicle to seat the body on the frame and tighten the right side mounts.
7. Install the jack stands on the left side of vehicle to support the body.
8. Loosen the lower body mounts on the left side.
9. Slightly lower the vehicle just enough to provide access to the left side upper body mounts.
10. Remove the upper body mounts one at a time and install the insulators.
11. Raise the vehicle to seat the body on the frame.
12. Tighten all body mounts.

**Tighten**

Tighten to 85 N·m (63 lb ft).

13. Remove the jack stands.
14. Lower the vehicle.

**Parts Information**

Part Number	Description	Qty
15899719	Insulator -- Body	12
15053229	Insulator -- Body	12

**Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
E9467*	Body Mount Insulator -- Installation	1.1 hrs
*This labor operation number is for bulletin use only. This number will not be published in the Labor Time Guide.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT  
VOLUNTARY  
TECHNICIAN  
CERTIFICATION